U.S. PUBLIC LAND CORNER MAINTENANCE


131

Corner ID: SW Sec.32, T16N-R3W

MONUMENT INFO

21603310000

	March 24, 2020	Al Hoff Gary L. Dechant	Existing Harrison, top broke off, all fencing gone, now in tillable field			
			Ti de la companya de	Bearing	Distance	
1)	Reset disturbed 1	1/16" in field, set down 10"		N89°42'19"W	26.31' (25.95')	
<u>2)</u>	Reset disturbed 1	1/4" iron pipe in field, set down 10"		N89°53'24"E	27.77' (27.95')	
<u>3)</u>	Set 3/4"x24" rou	nd iron bar in field, down 10"		S31°24'42"E	23.67'	
<u>4)</u>	Reset disturbed 1	1/16" round iron bar in field, set do	wn 10"	S89°59'34"E	59.77' (59.60')	
<u>5)</u>	Set 3/4"x24" rou	nd iron bar in field, down 10"		N19°32'36"W	30.85'	
		٨	1 4	-		

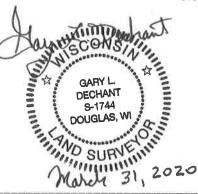

R 3 W. Fourth Principal Meridian, and I re-

established said corner according to the Wisconsin

Statutes as shown and described hereon.

84 I found

Garold A. Sime certify that on the 8th

June

(no evidence) of the section 32

History of corner establishment since Original Government Survey

Fred Holden was here in April of 1903 and had a sleigh shoe at corner, he was also here in Sept. of 1910

H. A. Sime was at this corner in Aug. 1961.
D. Malliet was near this corner in Oct. of 1976

Description of corner evidence found:

I set this corner on line with the West line of the NW% of Sec.32 projected south to intersect the existing fence line along the south line of the SEM-SEM, Sec.31. This location landed very close to the existing iron pipe(leaning) set by H.A. Sime.

