U.S. PUBLIC LAND CORNER MAINTENANCE

71

Corner ID: SE Sec. 18, T15N-R1E

41501180000

DATE	CREW	MONUMENT INFO
March 30, 2020	Zachariah P. Dechant	Existing Harrison, intact, down 4", 15' south of intersection of Norway
	Gary L. Dechant	Ave & Northridge Road, fence to the west

		Compass Bearing	Distance
1) Set 3/4"x24" round iron bar, down 8" at edge of fie	eld	N58E	105.41'
2) Set 3/4"x24" round iron bar, down 8" edge of field		S76E	92.70'
3) Set 3/4"x24" round iron bar, 4' NE of double 6"/12	" Hickory	S58W	51.40'
4) Set 3/4"x24" round iron bar, 4' SE of Locust sapling	ıg n	N76W	56.06'

Harrison and reference markers set on straight lines.

GARY L.
DECHANT
S-1744
DOUGLAS, WI

SURVE

of September 1982, I found (evidence) (no evidence) of the Southeast

R 1 E Fourth Principal Meridian, and I re-

established said corner according to the Wisconsin

Dated this 26th day of Jan. 1983.

Deputy County Surveyor

do hereby

20th

William C. Jung

Statutes as shown and described hereon.

corner of Section 18

certify that on the

L	lo	71	
41501	18	0000	>

History of corner establishment since Original Government Survey

O. R. Dahl was at this corner in December of 1868. Holden found the original corner here in November of 1907. Apparently he set an iron pipe here as shown in some unrecorded field notes.

Description of corner evidence found:

I dug and searched but could not find Holden's iron. I set the corner on line with Holden's iron pipe at the El/16SE and the fence corner at the NE Corner, and at a distance from the El/16SE equal to 1/3 of the distance between the El/16SE and the NE Corners. The road centerline to the North is thus almost perfectly on the section line as it should be according to the old Town Road Records. This location also fits other evidence in all (4) cardinal directions very well.

