
# 67

## U.S. PUBLIC LAND CORNER MAINTENANCE

Corner ID: NW Sec.22, T17N-R4W

21704160000

DATE	CREW	MONUMENT TYPE		
December 5, 2018	Zachariah P. Dechant Gary L. Dechant	·		ce. Set sign 1' north. of house-16031 Hammock
References:			Bearing	Distance
1) Set 3/4"x24" round iron bar, down 2" 6' east of triple 40" White Oak (1975 BT)			N10E	47.37'
shows as double 2) Set 3/4"x24"round iron bar, down 2" in lawn, 75' west of SW corner of house			N70E	20.75'
3) Set 3/4"x24" round iron bar, down 4", 4' NE of 5" Jack Pine			S50W	39.35'
4) Set 3/4"x24" round iron bar,	down 4", 5' SE of 8" Jack Pine		N60W	54.98'
	0	Alama.	+	

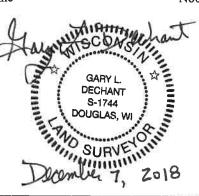

CERTIFICATE		CERTIFIED LAND CORNER	No. 67			
I, Harley A. Sime certify that on the	History Descrip		e Reverse Side or Maintenance			
Dated this 22 day of Jan. 19 76.  County Surveyor Title	ditions and evi	iron bar set by Duane Marten in Jan. 1973 in the consisting of three brace posts in one post being very old. This corner fits surroundidence very well and thus was accepted as the section har and replaced it with a Harrison marker.				
Description of corner and witness monuments, references and accessories used to perpetuate the original or re-established location of this corner:  Set a Harrison marker, up 2".  Section						
G. Sime  HARLEY A.  SIME  S-355 TOMAH, WIS.	l trees were blazed.	n&c in Double Oak  5" Oak  Set Harr. in fence, up 2"  By 3 brace posts  n&c in 18" Blk. Oak.	O = LOCATION CORNER  T 17 N R 4W  WISCONSIN			
SURVEY CONTROL ORDER						
Horizontal						
Vertical East (X)	WISCONSIN COORDII	NATE SYSTEM    Elevation (Z)   Zone   City, Village or Town   Sparta				

City, Village or Town

County of

Monroe

Zone

Corner

Control Sta. Name